TROUBLESHOOTING CHECKLIST ADAPTEC ACB-2322B

۰ Gets a 1790 at boot-up:

A 1790 Error is normal for an unformatted drive. Just $\beta_{i}\dot{e}ss\,\dot{F}1$ to continue

Long boot time:

C

the system will boot to the floppy drive. Then you @eh proceed drive even though it has not been formatted yet. You will have Some PC AT systems may continue to retry booting to the hard to Debug and format the drive. to allow this re-trying to continue for up to two minutes before

Can't read floppy or boot to A:

۵

drive. If only one drive is being used, only the last canbector on Check floppy cables; be sure J1 goes to both floggy drives. Be the twisted cable should be used. A floppy cable has wires 10sure that Pin 1 on the controller is connected to pin 1 of the 16 twisted between the two drive connectors.

٥ Check the drive select jumper on the hard disk drive; be sure Recal error, or no drive attached error:

controller is connected to Pin 1 of the drive. If only and drive is Check hard drive cables; Be sure J4 goes to Drive الله في عنه الله عنه الله الله عنه الله الله الله الله عنه ال that it is correctly set for the type of cable you $\mbox{grad}_{\rm using}.$ Drive 2, and J5 goes to both drives. Be sure that $p_{\rm IB}$ 1 on the

being used, only J5 and J4 should be used. Incorrect drive parameters:

Ο

for "bytes per sector", also for hard or soft sectoring. Consult ESDI drives have jumpers for "number of sectors per indck" and your drive vendor for proper settings of these jumpers.

٥ Misc. errors, or no format routine:

ρ Excessive defects, or fails to format: Check that the controller jumpers are correctly set.

Make sure the drive is ESDI certified. Check with the drive manufacturer

٥ Won't boot to C:

Check to see that the SETUP program and CMCS RAM show drive type 1 is selected.

- D required by the drive. Be sure that the +5V and $\pm \frac{1}{2}\dot{V}$ voltages are correct. Consult with the drive vendor for the Bollect drive Check that the power supply can support the algged current Check that the terminator on each drive is set Broperly. Intermittent operation errors, or Read/Write Greens:
- D ٥ needs this jumper installed on the controller books System hang or boot problems: power requirements. Try installing the BUS WAIT STATE jumper. The DTK 12% Minz system
- Replace the cables with known-good cables If none of the above steps cure the problem, they swap out components in this order and try again:

Swap the 2322B controller with another 2322B CANNONER Swap the drive with a known-good drive.

G

This equipment generates C. CERTIFICATION . T

radio or television reception if this equipment does cause interference to ment off and on, the user is which can be determined by turning the equiptested and found to complyacia and reversion reception. It has been type accordance with the specify, with the limits for a Class B computing device in are designed to provide reversions "subpart Jof Part I Soff FCC Rules", which residential installation. Howey protection against such interference in a occur in a particular installever, there is no guarantee that interference will not used property, that is, in stricting uses radio frequency, and if not installed and may cause interference to: accordc.nce with the manufacturer's instructions. one or more of the following encouraged to try to correct the interference glimedsures: ġ

Reorient receiving antenn

Plug the computer into a strong the receiver. receiver are on different brighterent outlet so that computer and Relocate the computer water in Move the computer awa

anch circuits.

If necessary, the user should the interview of an experienced radio/ television technician for a fixed consult the dealer of an experienced radio/ booklet prepared by the Failing nal suggestions. The user may find the following "How to Identify and Resolv sideral Communications Commission helpful.

available from the U.S. Governation IV Interference Problems. This booklet is Stock No. 004-000-00345-4 within ment Printing Office, Washington, D.C. 20402.

COPYRIGHT

© Copyright 1988 by Adaptine

may be reproduced, store-science. An ingints reserved. No part of this publication by any means, electronic/Mil altertieval system, or transmitted, in any form or wise, without the prior writter the chanical, photocopying, recording, or other-Milpitas, California 95035, https://docsent.or/Adaptec.inc...691 South Milpitas Blvd..

FIVE-YEAR

examination, disclosed to two:totion charges prepaid, and which are, after WARRANTY IS EXPRESSED Inseg Seller's satisfaction to be thus defective. THIS STATUTORY, OR IMPLIED, ING. 2010, CALL, OTHER WARRANTES, EXPRESSED, MERCHANTABILITY AND FITIS, U.D.N.G. THE IMPLIED WARRANTIES OF OTHER OBLIGATIONS OR LIVIESS FOR A PARTICULAR PURPOSE. AND OF ALL ASSUMES NOR AUTHORIZE'S UNITS ON THE SELLER'S PART, AND IT NEITHER ANY OTHER LIABILITIES IN CRAMY OTHER PERSON TO ASSUME FOR THE SELLER This worranty shall not opply XNECTION WITH THE SALE OF THE SALD ARTICLES. The Seller warrants that the TIME LIFE-TIME WARRANTY option, to (i) replacing or (tigations under this Warranty are limited, at its sole products which shall, within inscribing or (iii) giving credit for, any such has either been repaired orginal warranty period of any product which products to Seller. Buyer michaplaced by Seller. Prior to returning any Authorization ("RMA"). is request and obtain a Return Material subjected to misuse, negligitary the Seiler, or which shall have been provisions do not extend this not or accident. The aforementioned to the Seller's factory, transi invel(5) years from date of shipment, be returned order will be free from defe doducts to be delivered under this purchase repaired or altered, excepy to any of such products which shall have been use and service. Seller's obزرهرا المرابع المرابع

CHANGES

without reservation and within right to make changes in the product design notice. Adaptec reserves of information only and Issubject to change without The material in this guide is fire

If you require further intention "Sou" nonfication to its users

please contact your according or other technical support.

adaptec, 691 south milite here here

"bitas bivd. milpitas, california 95035 510041-00 SM/MAC 12/88

ACB-2322B Installation Guide